

Service Bulletin

Bulletin No.: 19-NA-115

Date: January, 2020

TECHNICAL

Subject: Rear Brake Squeal Noise

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2018	2020				
Cadillas	XT5	2017	2019	SOP August 5, 2019		All	All
Cadillac	XT6	2020	2020		August 5, 2019		
Chevrolet	Blazer	2019	2019				
	Traverse	2018	2020				
	Acadia (VIN N)	2017	2017				
	Acadia	2018	2019				
Holden	Acadia	2019	2019]			

Involved Region or Country	North America, N.A. Export Regions, Middle East, Australia, Europe, Russia, Israel, South Korea, Africa, Columbia, Chile and Peru.
Condition Some customers may comment on hearing a squeal noise coming from the	
Cause	The cause of the condition may be the current material used on the rear disc brake pad shim.
Correction	Note: The rear disc brake pads have been re-designed with new shim material, to eliminate the squeal.
Correction	Replace the rear disc brake pads with new design pads listed in the Part Table below. Refer to Rear Disc Brake Pads Replacement, in SI.

Parts Information

Causal Part	Description	Part Number	Qty
Х	PAD KIT-RR DISC BRK	84757793	1

Warranty Information

Repairs made for the specific concern within this bulletin may be covered under the New Vehicle Limited Warranty Bumper-to-Bumper terms (Canada Base Warranty).

Refer to the vehicle's Limited Warranty and Owner Assistance Information booklet for coverage details.

Labor Operation	Description	Labor Time
2481978*	Rear Disc Brake Pads Replacement	1.1 hr
Add	To Refinish Rotor - Both	0.6 hr
Add	To Refinish Rotor - One	0.5 hr
Add	To Replace Rotor - Both	0.4 hr
Add	To Replace Rotor - One	0.2 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	2	
Modified	Released August 14, 2019.	
	Revised January 17, 2020 — Added the 2020 Model Year and the Cadillac XT6.	